

# METHOD STATEMENT FOR THE INSTALLATION OF THE JISLON SATELLITE ISLANDS

## PROJECT INFORMATION

### Company Details:

Rediweld Rubber & Plastics Limited  
6/10 Newman Lane  
ALTON  
Hampshire  
GU34 2QR  
Tel: 01420 543007  
Fax: 01420 544090  
E-Mail: [info@rediweld.co.uk](mailto:info@rediweld.co.uk)



### Activity-Risk:

To install Rubber Island.



## IMPLEMENTATION & CONTROL OF RISK

Hazardous Task – Risk	Method of Control
<p>1. Put out warning signs and sufficient traffic management measures to ensure the safety of operatives, road users and pedestrians. Risk to operatives and third parties will be high.</p>	<p>Operatives will follow the correct procedure for accessing the site. Works vehicles will be safely positioned with amber beacons on. Warning signs and traffic management measures will be positioned, as per Chapter 8. The site will be clearly defined and barriered. Safety zones will be maintained at all times. Signs will be adequately placed and sandbagged if necessary. If two-way lights are to be used, cables will be run along edges and channel strips will be used. A safe, signed pedestrian route will be provided and maintained at all times. Reversing operations will be minimised.</p>
<p>2. Mark road where Satellite Island is to be positioned, and assemble modules accordingly (this is a 2 man lift as the product weighs approx. 43 kilos). Risk to operatives will be medium. Risk to third parties will be low.</p>	<p>Operatives will have adequate training in manual handling and will employ manual handling techniques to lift individual rubber units at all times. Operatives will wear gloves and safety boots, at all times to prevent trapped fingers and damaged feet. A first aid box will be provided on site at all times. Operatives will only work within the site ‘working space’ to protect both third parties.</p>
<p>3. Loose lay modules, Ensure the two modules are butted tightly together, drill and fix using a 14mm drill bit, commence drilling through holes to a depth of 300mm from the module surface into the carriageway, The drill used will be a Hilti T15 or T21 hammer drill (<i>or similar</i>) attached to a 3 kva generator via a 25 m. 110 v extension lead. Risk to operatives will be medium. Risk to third parties will be low.</p>	<p>Plans of services will be obtained prior to commencing work on site. A visual survey of the area and a ‘CAT’ scan will be carried out prior to drilling. Operatives will wear appropriate eye, ear and feet protection. Dust masks will be worn, if necessary. Regular checks will be made on the condition of airlines and the tightness of fittings. Hoses will be run safely and will avoid pedestrian routes. To prevent vibration white finger, reduced vibration equipment will be used, regular job rotation will be implemented and operative’s hands will be kept as warm as possible. Fuel for generators will be stored in suitable containers in a</p>
<p>4. Blow out fixing holes using a long nosed air gun, powered by a 120psi portable compressor, insert resin commencing at base of hole, 2 to 3 pumps are required using a resin gun supplied by Rediweld Risk to operatives will be medium. Risk to third parties will be low.</p>	

<p>5. Insert M10 x 150mm Coachscrew through M10 washer with the RediPlug fitted on the end, then hammer the fixing through the holes in the moduels into pre-drilled holes in road surface. Once all fixings have been tightened then use a rubber bung to cover the holes. Risk to operatives will be low. Risk to third parties will be low. <b>Warning – resin will harden within 25 minutes.</b> <b>Do not over tighten.</b></p> <p>6. Take the 80mm or 130mm dia. Jislon Pole Cone with an NS male fixing and using an installation spanner fix into pre-cast anchor female fixings, repeat until all Poles Cones are fitted.</p> <p>7. Remove all work debris &amp; personal rubbish from site. Risk to operatives will be medium. Risk to third parties will be low.</p> <p>8. Remove traffic management signs and barriers. Risk to operatives and third parties will be high.</p>	<p>secure area. Caps will be kept on fuel containers and refuelling will not take place near storm drains or watercourses. Spill kits and a fire extinguisher will be available on site at all times. (Refer to COSHH sheets for petrol).</p> <p>Operatives will wear appropriate P.P.E – gloves, goggles, masks and long sleeves. Operatives will only use the air gun within the site ‘working space’ to protect third parties. Resin containers will be stored in a secure area, with caps on to prevent spillage / water contamination. (Refer to COSHH sheets for resin). Safety measures relating to the generator, portable compressor and hoses will apply as outlined in section 3.</p> <p>As outlined earlier.</p> <p>Operatives will have good hygiene standards, use gloves (where practical), clean and cover cuts and will carry a Leptospirosis card.</p> <p>Operatives will comply with the sequence of removing signs as per Chapter 8 when dismantling traffic management measures.</p>
--	---